





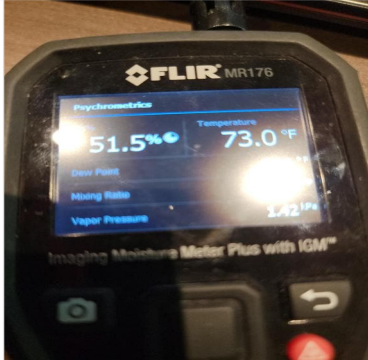

### Affected Area HVAC Readings

#	Time	Room	Relative Humidity	Specific Humidity	Air Temperature	Notes & Photos
1	Nov 5, 10:04 AM	Dining Room	35%	45.1 gpp	75°F	

### Affected Area: Kitchen

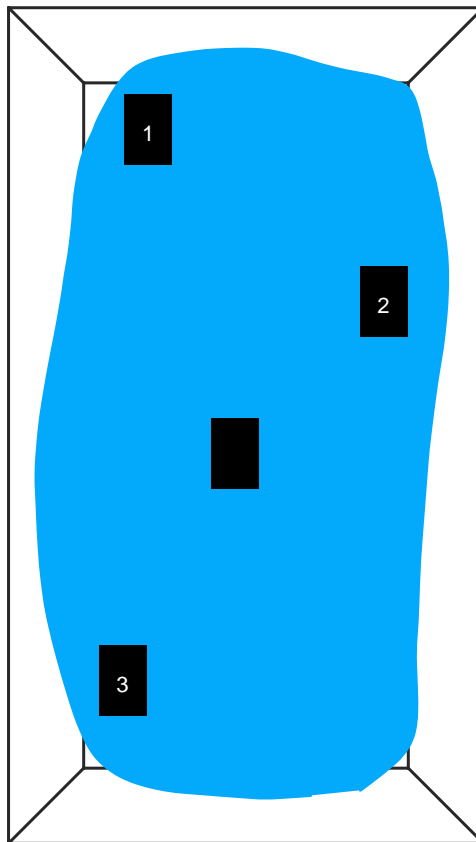

Point 1: Moisture Point 1

1.1: Wood Sill Plate <a href="#">Tramex Wood 30%</a> Dry Standard: 5%					
#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
1	Nov 5, 10:20 AM	Tramex Wood 30%	25%		
1.2: Carpet <a href="#">Delmhorst 100%</a> Dry Standard: 0%					
#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
1	Nov 5, 10:21 AM	Delmhorst 100%	100%	65°F	
1.3: Drywall <a href="#">Tramex 100%</a> Dry Standard: 5%					
#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
1	Nov 5, 10:23 AM	Tramex 100%	75%	55°F	

Point 2: Moisture Point 2

2.1: Carpet <a href="#">Delmhorst 100%</a> Dry Standard: 0%					
#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
1	Nov 5, 10:25 AM	Delmhorst 100%	65%	67°F	
2.2: Drywall <a href="#">Tramex 100%</a> Dry Standard: 5%					
#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
1	Nov 5, 10:25 AM	Tramex 100%	75%	66°F	

Point 3: Moisture Point 3

3.1: Carpet <a href="#">Delmhorst 100%</a> Dry Standard: 0%					
#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
1	Nov 5, 10:25 AM	Delmhorst 100%	100%	65°F	



#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
1	Nov 5, 10:25 AM	Tramex Wood 30%	100%	69°F	



#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
1	Nov 5, 10:26 AM	Tramex 100%	100%	70°F	

**Equipment List: Kitchen**

**Dehumidifier: Phoenix 300 MAX LGR (102)**


Placed	Removed	Power	Energy usage	Days on site
Nov 5, 10:37 AM	Still on site	1.20 kW	0.74 kWh	1 day

#	Time	Relative Humidity	Specific Humidity	Air Temperature	Grain Depression	Hours Running	Notes & Photos
1	Nov 5, 10:43 AM	15%	42.7 gpp	100°F	2 gpp	0.30 hrs	

**Air Movers: Kitchen**


Name	Placed	Removed	Energy usage	Days on site
Phoenix FOCUS (AM012)	Nov 5, 10:41 AM	Still on site	0.16 kWh	1 day
Phoenix FOCUS (AM010)	Nov 5, 10:41 AM	Still on site	0.17 kWh	1 day
Phoenix FOCUS (AM009)	Nov 5, 10:40 AM	Still on site	0.17 kWh	1 day
Phoenix FOCUS (AM008)	Nov 5, 10:40 AM	Still on site	0.17 kWh	1 day
Phoenix FOCUS (AM007)	Nov 5, 10:40 AM	Still on site	0.17 kWh	1 day

Affected Area: Dining Room



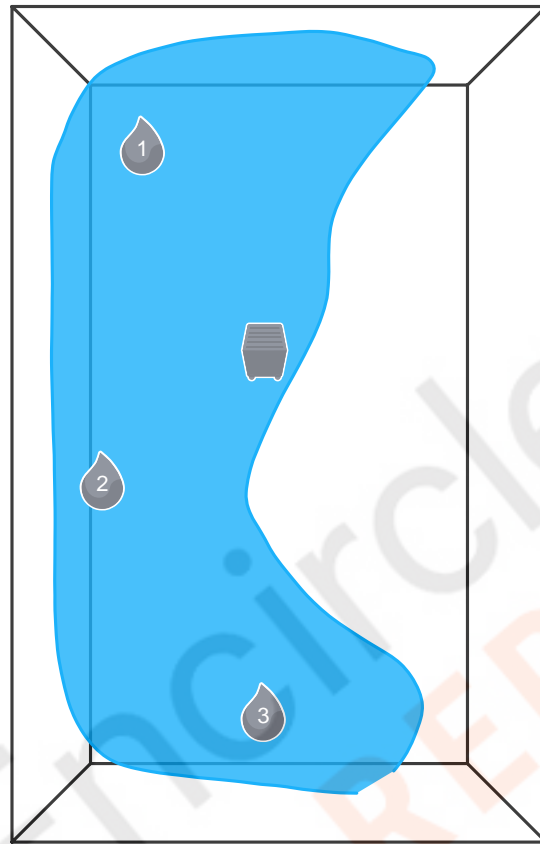


Point 1: Moisture Point 1




1.1: Wood Sill Plate 25%					Still Wet
<a href="#">Tramex Wood 30%</a> Dry Standard: 5%		Nov 5 Nov 6			
#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
1	Nov 5, 10:26 AM	Tramex Wood 30%	25%		
1.2: Carpet 80%					Still Wet
<a href="#">Delmhorst 100%</a> Dry Standard: 0%		Nov 5 Nov 6			
#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
1	Nov 5, 10:26 AM	Delmhorst 100%	80%	66°F	

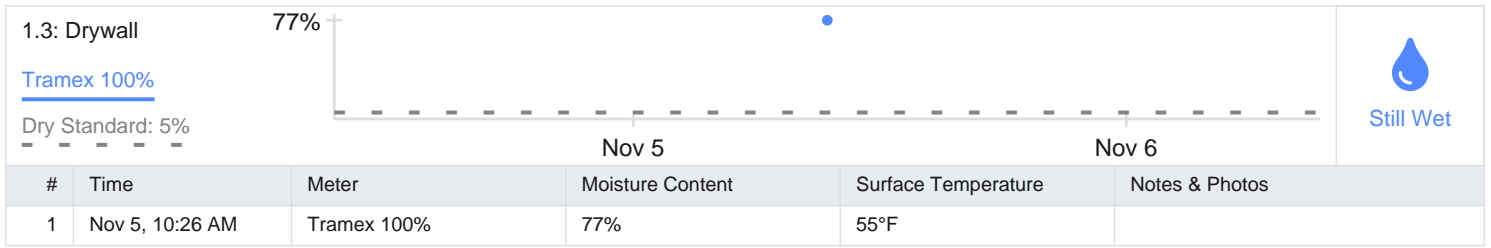

Point 2: Moisture Point 2

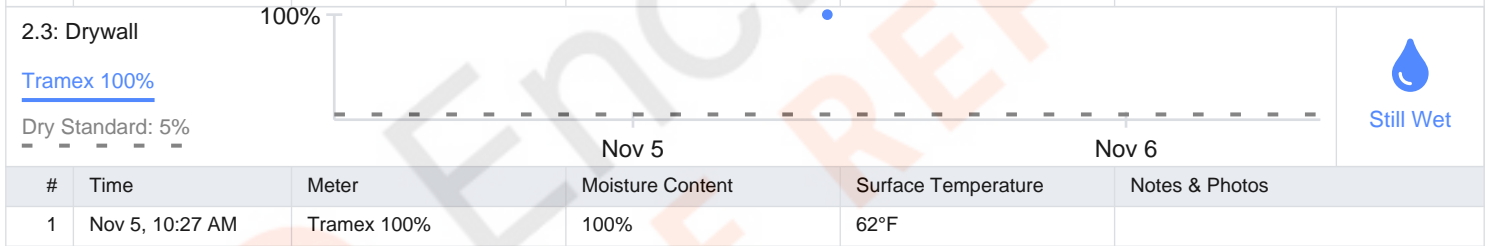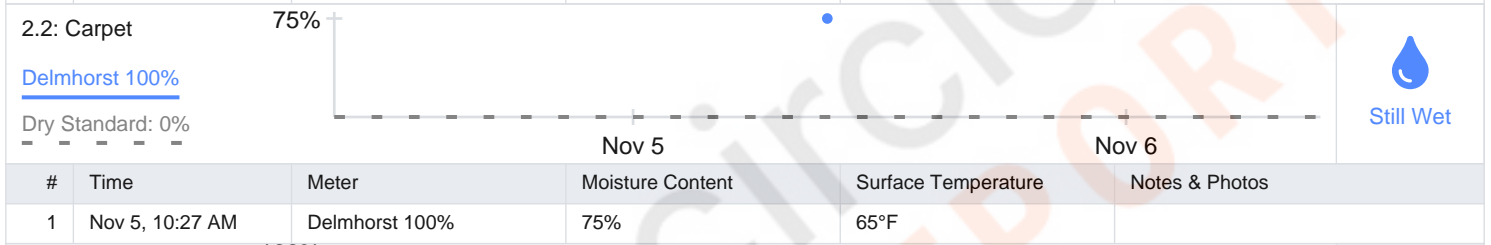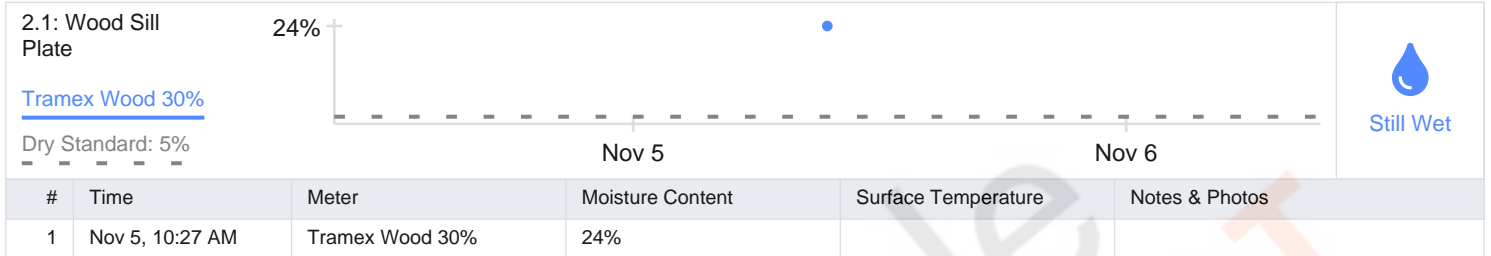

Point 3: Moisture Point 3

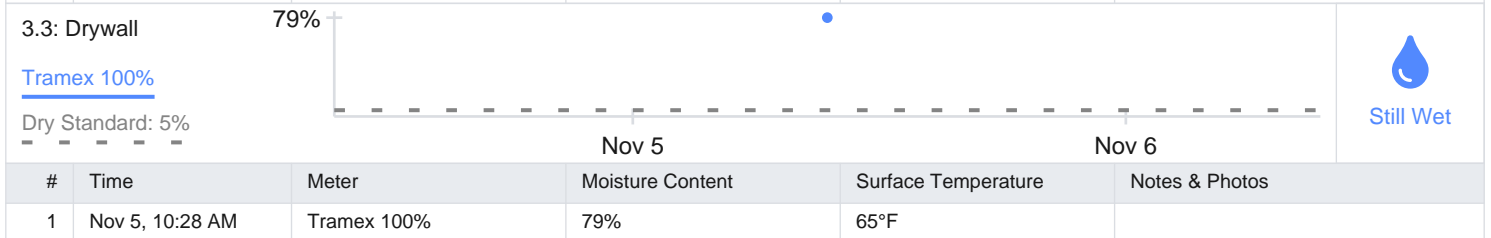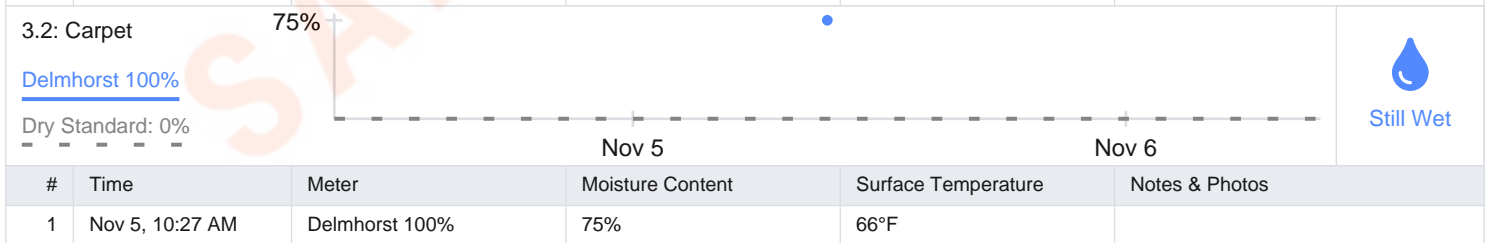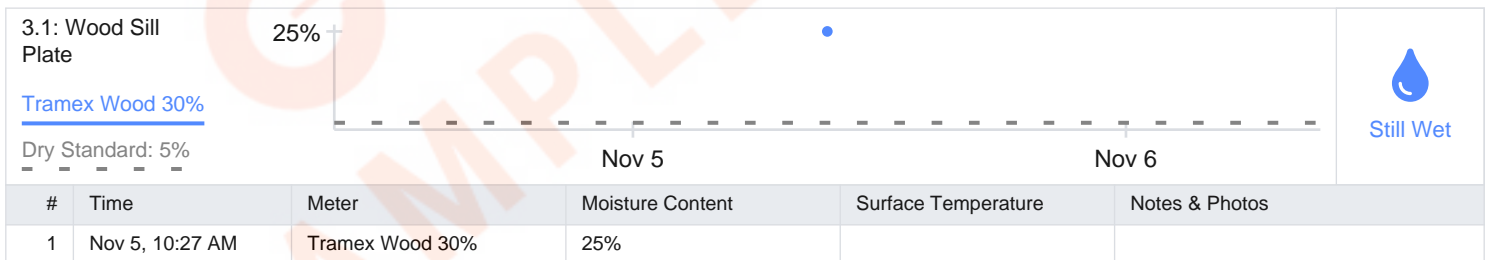

Equipment List: Dining Room

Dehumidifier: Phoenix DryMax LGR (DH008)


Placed Nov 5, 10:39 AM      Removed Still on site      Power 0.68 kW      Energy usage 0.41 kWh      Days on site 1 day

#	Time	Relative Humidity	Specific Humidity	Air Temperature	Grain Depression	Hours Running	Notes & Photos
1	Nov 5, 10:43 AM	14%	42.3 gpp	102°F	3 gpp	0.50 hrs	

Air Movers: Dining Room


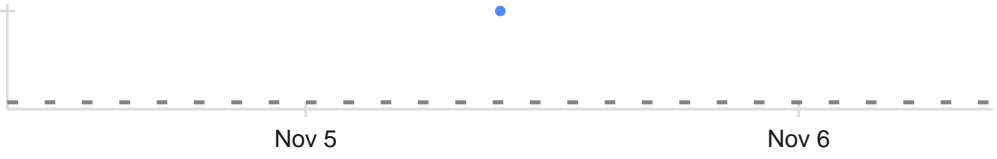


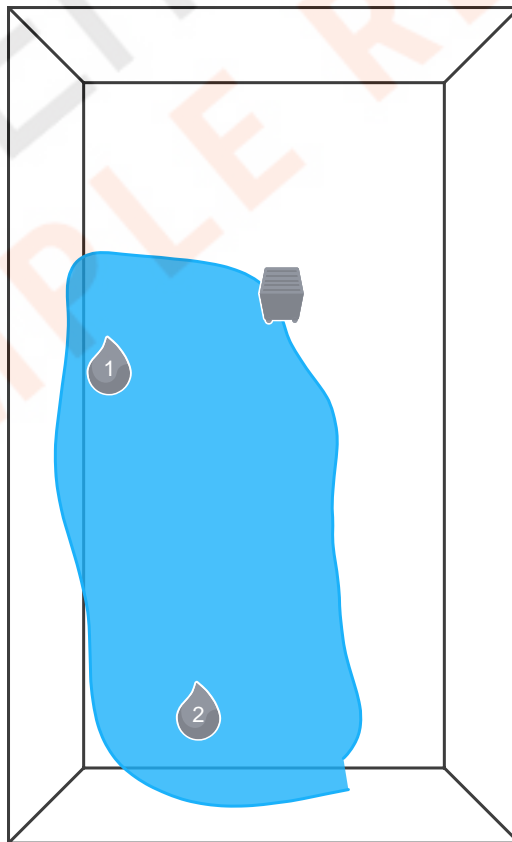

Name	Placed	Removed	Energy usage	Days on site
Phoenix FOCUS (AM021)	Nov 5, 10:43 AM	Still on site	0.16 kWh	1 day
Phoenix FOCUS (AM020)	Nov 5, 10:42 AM	Still on site	0.16 kWh	1 day
Phoenix FOCUS (AM019)	Nov 5, 10:42 AM	Still on site	0.16 kWh	1 day
Phoenix FOCUS (AM018)	Nov 5, 10:42 AM	Still on site	0.16 kWh	1 day
Phoenix FOCUS (AM016)	Nov 5, 10:42 AM	Still on site	0.16 kWh	1 day
Phoenix FOCUS (AM014)	Nov 5, 10:42 AM	Still on site	0.16 kWh	1 day
Phoenix Centrifugal (1002)	Nov 5, 10:42 AM	Still on site	0.17 kWh	1 day
Phoenix FOCUS (AM011)	Nov 5, 10:42 AM	Still on site	0.16 kWh	1 day
Phoenix FOCUS (AM013)	Nov 5, 10:41 AM	Still on site	0.16 kWh	1 day

Affected Area: Living Room


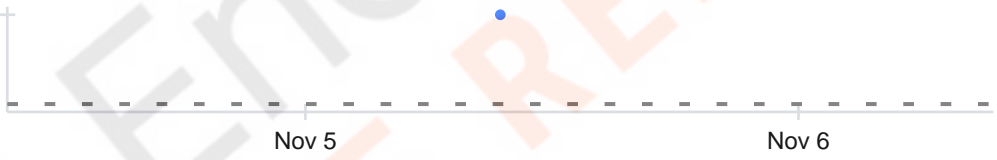

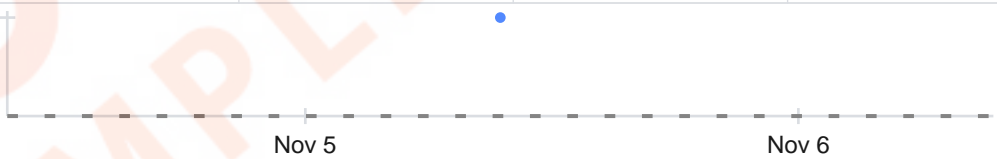






Point 1: Moisture Point 1

1.1: Wood Sill Plate 25% <a href="#">Tramex Wood 30%</a> Dry Standard: 5%					 Still Wet
					
#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
1	Nov 5, 10:28 AM	Tramex Wood 30%	25%	65°F	
1.2: Carpet 100% <a href="#">Delmhorst 100%</a> Dry Standard: 0%					 Still Wet
					
#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
1	Nov 5, 10:28 AM	Delmhorst 100%	100%	62°F	
1.3: Drywall 80% <a href="#">Tramex 100%</a> Dry Standard: 5%					 Still Wet
					
#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
1	Nov 5, 10:28 AM	Tramex 100%	80%	66°F	

Point 2: Moisture Point 2

2.1: Wood Sill Plate 22% <a href="#">Tramex Wood 30%</a> Dry Standard: 5%					 Still Wet
					
#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
1	Nov 5, 10:29 AM	Tramex Wood 30%	22%	63°F	
2.2: Carpet 75% <a href="#">Delmhorst 100%</a> Dry Standard: 0%					 Still Wet
					
#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
1	Nov 5, 10:29 AM	Delmhorst 100%	75%	65°F	
2.3: Drywall 100% <a href="#">Tramex 100%</a> Dry Standard: 5%					 Still Wet
					
#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
1	Nov 5, 10:32 AM	Tramex 100%	100%	70°F	

Equipment List: Living Room

Dehumidifier: Phoenix DryMax LGR (DH007)


Placed	Removed	Power	Energy usage	Days on site
Nov 5, 10:38 AM	Still on site	0.68 kW	0.42 kWh	1 day

#	Time	Relative Humidity	Specific Humidity	Air Temperature	Grain Depression	Hours Running	Notes & Photos
1	Nov 5, 10:44 AM	13%	39.2 gpp	102°F	6 gpp	0.50 hrs	

Air Movers: Living Room

Name	Placed	Removed	Energy usage	Days on site
Phoenix FOCUS (AM028)	Nov 5, 10:43 AM	Still on site	0.16 kWh	1 day
Phoenix FOCUS (AM023)	Nov 5, 10:43 AM	Still on site	0.16 kWh	1 day
Phoenix FOCUS (AM022)	Nov 5, 10:43 AM	Still on site	0.16 kWh	1 day

Affected Area: Hallway

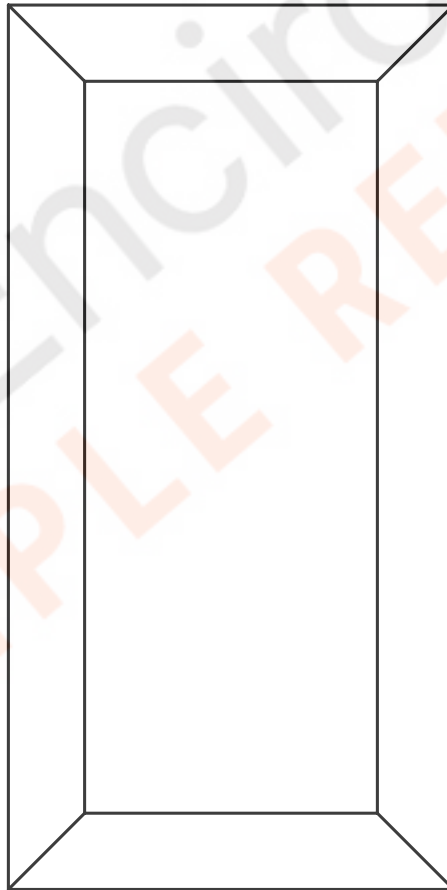

No readings

Equipment List: Hallway

None